

Production: **OnAir 1 & 2 modification**

## Problem

OnAir output 1 & 2 do not switch.

## Cause:

Due to the switch over from +/-18V rail voltage to +/-15V the series resistance is too high.

## Solution:

On the Airlab6 mux board lower the resistance of R55 & R57 from 560Ohm to 330Ohm

